DOE/NASA/20320-38 NASA TM-82803

NASA-TM-82803 19820011676

# Experience with Modified Aerospace Reliability and Quality Assurance Method for Wind Turbines

William E. Klein National Aeronautics and Space Administration Lewis Research Center

LIBRARY COPY

MAR 2.2 1982

LANGLEY RESEARCH CENTER LIBRARY, NASA HAMPTON, VIRGINIA

Work performed for U.S. DEPARTMENT OF ENERGY Conservation and Renewable Energy Division of Wind Energy Systems

Prepared for Nineth Annual Engineering Conference on Reliability Hershey, Pennsylvania, June 16-18, 1982

### NOTICE

This report was prepared to document work sponsored by the United States Government Neither the United States nor its agent, the United States Department of Energy, nor any Federal employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product or process disclosed, or represents that its use would not infringe privately owned rights

Experience with
Modified Aerospace Reliability
and Quality Assurance Method for
Wind Turbines

William E. Klein National Aeronautics and Space Administration Lewis Research Center Cleveland, Ohio 44135

Work performed for U.S. DEPARTMENT OF ENERGY Conservation and Renewable Energy Division of Wind Energy Systems Washington, D.C. 20545 Under Interagency Agreement DE-Al01-76ET20320

Prepared for Nineth Annual Engineering Conference on Reliability Hershey, Pennsylvania, June 16-18, 1982

N82-19550 #

Experience with Modified Aerospace Reliability and Quality
Assurance Method for Wind Turbines\*

William E. Klein National Aeronautics and Space Administration Lewis Research Center Cleveland, Ohio

### Abstract

This paper describes the original Safety, Reliability and Quality Assurance (SR&QA) approach developed for the first large wind turbine generator project, Mod OA. The SR&QA approach to be used had to assure that the machine would not be hazardous to the public or operating personnel, would operate unattended on a utility grid, would demonstrate reliable operation and would help establish the quality assurance and maintainability requirements for future wind turbine projects. Since the utlimate objective of the wind energy program is to provide wind power at a cost competitive with other energy sources, the final SR&QA activities were to be accomplished at a minimum of cost and manpower. The final approach consisted of a modified Failure Modes and Effects Analysis (FMEA) during the design phase, minimal hardware inspection during parts fabrication, and three simple documents to control activities during machine construction and operation. Five years experience has shown that this low cost approach has worked well enough that it should be considered by others for similar projects.

### Introduction

The NASA Lewis Research Center is conducting research and development of large horizontal axis Wind Turbine Generators (WTG's) for the Department of Energy as one phase of the overall Federal Wind Energy Program. Wind turbines ranging in size from 100 kilowatts (kW) to 4000 kW have been designed and built as part of this program. Two machines of about 7200 kW are presently in the design stage. The object of the program is to develop wind turbines which will generate electricity at a cost which is competitive with alternatives, particularly oil. This paper describes the SR&QA approach originally developed for the first large wind turbine project, Mod OA, a 200 kW, 125-foot diameter machine. This project has been a combination of in-house and contracted effort and is a unique joining of aerospace technology and standard utility practices. This project formed the base for future development of large wind turbines and this SR&QA approach was subsequently applied to other NASA/DOE WTG projects.

# Description of Original Design

A photograph of one Mod OA machine, located on Culebra Island, Puerto Rico, is shown as Fig. 1. Three similar machines are located in Clayton, New Mexico, on Block Island, Rhode Island, and on Oahu, Hawaii. The two blades measure 125 feet, tip-to-tip. The hub centerline is 100 feet above ground level. The blades rotate at 40 rpm on two machines and 31.5 rpm on the other two machines. The blades are mounted on the rotor hub, as shown in the cutaway drawing included as Fig. 2. The pitch actuator pitches the blades through a set of bevel gears located inside the hub. The hub is attached to a low speed shaft which drives a speed increaser gearbox. In the original design, a high speed shaft transmitted power to V-belts which drove a synchronous alternator. Each machine is housed in an 8-foot diameter nacelle and is mounted on a turntable bearing located on top of a truss tower. A yaw drive system keeps the machine aligned with the wind.

In the original design, the wind turbine was controlled by a microprocessor, two closed loop servo systems, and a safety system. The microprocessor is the heart of the control system. It monitors machine status and wind conditions. When the wind speed reaches 10 mph, the microprocessor signals the pitch controller to start pitching the blades, gradually increasing blade rotation. When the alternator reaches synchronous speed, it is synchronized with the utility grid. After synchronization, the blades remain in the full power position, generating increasing power as the winds increase, until the full output of 200 kW is reached at a wind speed of about 20 mph. As winds increase further, the blades pitch towards the feather position, spilling some of the wind, to maintain the 200 kW output.

If the power drops below -10 kW, the machine is shut down. If the wind speed increases above 40 mph, the machine is shut down to avoid high blade loads. When the wind speed drops back to 35 mph, the machine is restarted. The microprocessor also monitors several noncritical variables to shut the machine down if necessary.

In the original design, one closed loop servo system regulated the pitch of the blades. Blade pitch regulates machine speed from initial blade rotation until synchronization with the utility grid and regulates the power generated after synchronization. The second closed loop servo measured the difference between the actual wind direction and the nacelle direction to keep the machine aligned with the wind. The machine operates with the blades downwind and is kept aligned within 25° of the wind direction.

N82-19550#

<sup>\*</sup>Revised version of NASA TM-79284, "Modified Aerospace Reliability and Quality Assurance Method for Wind Turbines," by William E. Klein presented at the Reliability and Maintainability Symposium, January 22-24, 1980.

The safety system, as the name implies, measures several operating variables, shutting the machine down if any of these variables go out of limits. These variables include speed, current, pneumatic and hydraulic pressures, several temperatures, and vibration. In most cases, the safety system shutdown signal goes into the microprocessor, but there are several signals which directly shut the machine down, regardless of what the microprocessor, the control system, or the safety system are doing.

### Background

The Reliability and Quality Assurance (R&QA) Office was given the responsiblity to determine the safety, reliability, and quality assurance program that was to be initiated for these machines. The program had to be low cost and was further complicated by a unique combination of in-house and contract effort. The machine was designed in-house. Originally, this was a one machine program with options for two more machines. The schedule was very tight. Therefore, Lewis Research Center ordered a few long-lead items for all three machines, several additional items for two machines, and all hardware for the first machine. The Department of Energy quickly exercised the options for the additional two machines. The first machine was assembled in-house. The contractor was responsible for erection of the first machine, assembly and erection of the second machine (including the purchase of the remaining parts), and essentially all phases of the third machine. When the fourth machine was added later. the contractor was given total responsiblity for that machine. This meant that the SR&QA program had to operate under several combinations of in-house and contracted effort. The operation of the machine by the utility also had to be considered.

# Safety and Reliability Approach

After considering numerous R&QA and safety techniques, a modified FMEA was chosen to be the main tool for listing and analyzing the various possible failures, and the results or effects of those failures. For the purposes of this project, the FMEA was performed for each functional mode of a system, subsystem, or component.

The analysis was qualitative in nature and the actual probability of occurance of a failure was not considered. However, the more probable failures were considered for possible redesign or addition of redundant systems, particularly for the failures that would have severe consequences. The basic ground rule used throughout the analysis was that no single point failure would be catastrophic even if a previous undetected failure had already occurred. For single point failure items such as the blades, tower, machine bedplate, etc. it was verified that the item had been designed to a safe operating life with a significant factor of safety.

The FMEA has been used extensively for design and operational safety reviews. It emphasizes the criticality of some hardware such as blades and hub. While performing the FMEA, it soon became obvious that a significant overspeed would be the worst possible failure, since it could result in throwing a blade. The consequences of all other failures would be relatively minor by comparison. Based on this

finding, several design changes were made and redundant systems added. A disc brake was added to the high speed shaft to stop the rotor, even with the blades in the full power position. Also, a redundant overspeed switch was added that would operate the brake directly, rather than acting through the safety system as most of the other sensors do. The FMEA gives project management a qualitative evaluation of the degree of the risk the design imposes on both personnel and machine safety. Trade offs of degree of risk versus the need for additional redundancy or periodic inspection or maintenance can then be assessed. The FMEA has proven very useful when new design changes were being considered.

To complete the reliability phase of the original program, a simple Discrepancy Report (DR) form was developed as the main failure reporting system. A sample DR is included in Fig. 3. The DR form is also used to track failure analysis, when required, to assure initiation of engineering changes and to help control configuraton. The form is based on discrepancy and failure report forms used in earlier

programs and works quite well.

Experience showed us that critical components need to be inspected at the vendors plant during machining and assembly to save cost and schedule problems later. We also found that it was wise to perform some inspection and checkouts of the more important fabricated hardware, such as the switchgear. Where inspection at the vendors plant was not practical, receiving inspection activity was augmented. Highly stressed unique hardware such as the blades and hub were of particular concern. Further developments indicated the need to maintain dimensional records of critical components during assembly and maintenance operations to allow a continuing assessment of component performance in areas such as wear rates of bearings, deformation of structural elements, etc. The one area where it has not been necessary to perform much inspection is for commercial, off-the-shelf components. We have experienced very few difficulties in this area.

Two more activities round out the quality efforts on the project. An Engineering Work Order form is used to document changes made to the system. This form is virtually identical to the DR form in Fig. 3, except for the Material Review Board items. This form documents the change to be made and is used for configuration control. The form also assures all personnel that the project manager has given his approval to make the change. Finally, a daily log is kept for each phase of the project to record all

significant activities.

Most of the above discussions relating to Discrepancy Reports, Engineering Work Orders, inspecton records (for recording dimensions, etc.) and the daily log was basically for our in-house efforts. However, we have been very successful in having each of our contractors and each utility use their own internal paperwork system to perform the intent of each of the above documents. The contractors maintain a daily log to complete the the R&QA requirements. Each utility maintains a daily log and reports all failures on their weekly summary reports. The reader can refer to Ref. I for more details on the original SR&QA program and how it was set up.

Early experince with the first machines indicated that several design changes were desireable. The contractor was made totally responsible for most of the changes, including the design, changing drawings, work coordination, etc. One example included changing the alternator to a direct drive system, eliminating a longer high speed shaft, two high speed bearings and the drive belts. This change has been made only on the fourth machine at this point. The project still desires to maintain the flexibilty of being able to change rotor speeds by changing the belts and pulleys on two of the machines. A decision has not been made on converting the fourth machine. A second example involved adding an additional wind speed sensor mounted on the top of the nacelle. This sensor axis is fixed parallel to the nacelle so that the sensed wind speed acts as a redundant check on both wind speed and direction. This eliminated the need to use signals from the meterological tower and greatly simplified the hardware that was needed to perform the redundant checks. A third example was to use the vaw error signal, which was already in the microprocessor, to command the yaw function of the machine. This completely eliminated one of the closed loop control systems. These last two changes, plus several more minor changes, made the microprocessor and the control program more complicated. but eliminated a large amount of electronics and a number of relays. Experience has shown that the microprocessor has been much more reliable than most of the other electronic hardware.

The above changes were listed for several reasons. The original SR&QA program maintained the desired controls on the work performed and the proper configuration control, while maintaining the required redundancy and maintaining safe operation. Each change was reviewed to be sure that it improved the reliability and/or safe operation of the machine. Each change was also thoroughly reviewed against the FMEA to be sure that the safety or reliability guidelines were not compromised. Because of the numerous changes to the program, we have just completed a contract which updated the FMEA. The FMEA was completely reviewed and updated as necessary. The periodic reviews performed prior to each change have fulfilled a useful function, because there were no safety problems or lack of redundancy uncovered during the update.

As the machines have gained operating time and federal manpower cutbacks have occurred, more and more of the maintenance and inspection activites have been contracted out. Contracts have been awarded to the utilities to do the routine maintenance and inspection activities. Also, the original machine contractor is taking over more and more of the non-routine maintenance and inspection activities. As this change has been taking place, virtually no change in the original SR&QA approach has been necessary.

A wind turbine experience data bank has been established for all of the wind turbines in the Department of Energy/NASA programs (Mod OA, Mod 1, Mod 2, etc.). A summary of all Discrepancy Reports, Engineering Work Orders, and Project Information Release reports (PIR's) are being entered into the data bank. (A PIR is an informal report that allows preliminary release of machine performance data, trade-off studies, design information, etc.) The

search program is very flexible and allows searches by system, sub-system, part, dates, machine number, plus many other choices. The program will also calculate MTBF for any desired category. This has proven very valuable and time saving when the operating experience on some part or system is desired. A printout of a sample search is included as Table 1.

### Conclusion

The SR&QA approach described above was initiated on what was basically a research and development project and then revised and expanded as the project evolved. Part of the safety and reliability requirements are met by performing a modified FMEA during the design phase. A Discrepancy Report is used to record all failures and discrepancies. Part of the quality requirements are met by performing some vendor inspections and inspecting all machined items and most of the fabricated items upon delivery. An inspection report is kept, recording all important dimensions. An Engineering Work Order form is used for configuration control. A daily log rounds out the quality control activities.

This SR&QA approach has been successful in assuring safe operation of the units and in demonstrating those aspects of standard safety, reliability and quality practices which are most applicable and cost effective to this type hardware. We have been getting good dimensional data on critical hardware and we have a good record of the configuration of each machine. The first Mod OA has accumulated 12,000 hours of synchronized time and has reached a Mean Time Between Failures (MTBF) of 360 hours. The accumulated run time of all four machines has reached 34,000 hours with a MTBF of 450 hours. Although this sounds low, several utilities have told us they feel this is excellent for this stage of a development program for a new power source. Experience has shown that the SR&QA approach we developed for the Mod OA program has been suffficiently successful that similar approaches are being instituted on the newer, more advanced machines leading to low cost commercialization of wind turbines.

The SR&QA approach described in this paper has worked well enough that we are recommending that such an approach be considered for other projects of similar complexity. The prime considerations are that the SR&QA approach needs to be simple, reasonable, and flexible.

### Reference

1. W. E. Klein, "Modified Aerospace Reliability and Quality Assurance Methods for Wind Turbines," NASA TM-79284, Prepared for Annual Reliability and Maintainability Symposium, January 22-24, 1980.

### Biography

William E. Klein, P.E. NASA Lewis Research Center 21000 Brookpark Road Cleveland, Ohio 44135

### 1982 ENGINEERING CONFERENCE ON RELIABILITY FOR THE ELECTRIC POWER INDUSTRY

Mr. Klein is the Product Assurance Manager for the 200 kW Wind Turbine Project, which is being managed by the Lewis Research Center for the Department of Energy. Since 1977, he has been responsible for all reliability and quality assurance activities for this program. He is also Product Assurance Manager for a 7200-kW low-cost wind turbine project, an in-house low cost wind turbine project, and for the 100-kW wind turbine being used for supporting research and technology at Lewis Research Center's Plum Brook Station. In 1976 and 1977, he was Product Assurance Manager for the Centaur Launch Vehicle inertial guidance system. From 1974 through 1976, he was Flight Systems Safety Engineer for the Canadian Communication Technology Satellite and contract auditor for launch vehicle contracts. From 1970 through 1974 he was the Project Engineer and from 1964 through 1970 he was a System Engineer (Mechanical and Electrical) at two large test stands at the Plum Brook Station. Mr. Klein received his Bachelor of Mechanical Engineering degree from General Motors Institute in Flint, Michigan, and his Master of Science in Mechanical Engineering degree from Case Institute of Technology, Cleveland, Ohio.

### TABLE I. - SAMPLE DATA BANK SEARCH

DATE OF REQUEST --- FEBRUARY 11, 1982

SAMPLE DATA BANK SEARCH FOR TM-82803 (0A-1, PITCH SYSTEM, FLUID COUPLING)

PROGRAM MICROFICHE # REPORT NAME 2030-1

REPORT TYPE REPORT DATE DEC 3 77(77337) PITCH SUB-SYSTEM HYD SUPPLY

PART NAME FLUID COUPLING SERIAL NUMBER DRAWING NUMBER SYNC TIME 0

MANUFACTURER MODEL NUMBER

MACHINE NUMBER

REFERENCE DOCUMENTS

DEUBLIN COUPLING LEAKING. DEUBLIN REPLACED.

PROGRAM
OA

MICROFICHE # REPORT NAME REPORT NUMBER
2038

REPORT TYPE
MODIFICATION
DAN 4 78(78004)
PITCH

PART NAME
FLUID COUPLING

MICROFICHE # REPORT NAME
DR SYSTEM
HYD SUPPLY

PART NAME
FLUID COUPLING

MICROFICHE # REPORT NAME
DR SYSTEM
HYD SUPPLY

DRAWING NUMBER
SYNC TIME
11

MANUFACTURER MODEL NUMBER

MACHINE NUMBER

REFERENCE DOCUMENTS

COAXIAL FLOW LINE NOT CENTERED---RUBBING ON WIRES IN 40 RPM SLIP RING. COLLAPSED SPONGE MATERIAL WHICH CENTERS DEUBLIN IN BRACKET

PROGRAM MICROFICHE # REPORT NAME 2066

REPORT TYPE REPORT DATE SYSTEM SUB-SYSTEM HYD SUPPLY

PART NAME SERIAL NUMBER DRAWING NUMBER SYNC TIME FLUID COUPLING 1873

MANUFACTURER MODEL NUMBER

MACHINE NUMBER

REFERENCE DOCUMENTS

H.P. DEUBLIN LEAKS, H.P. DEUBLIN REPLACED.

PROGRAM
OA

MICROFICHE # REPORT NAME 2099 NUMBER
2099

REPORT TYPE REPORT DATE SYSTEM SUB-SYSTEM HYD SUPPLY

PART NAME FLUID COUPLING

SERIAL NUMBER

DRAWING NUMBER
SYNC TIME
0

MANUFACTURER MODEL NUMBER

MACHINE NUMBER

REFERENCE DOCUMENTS

HIGH PRESSURE DEUBLIN COUPLING FAILED.

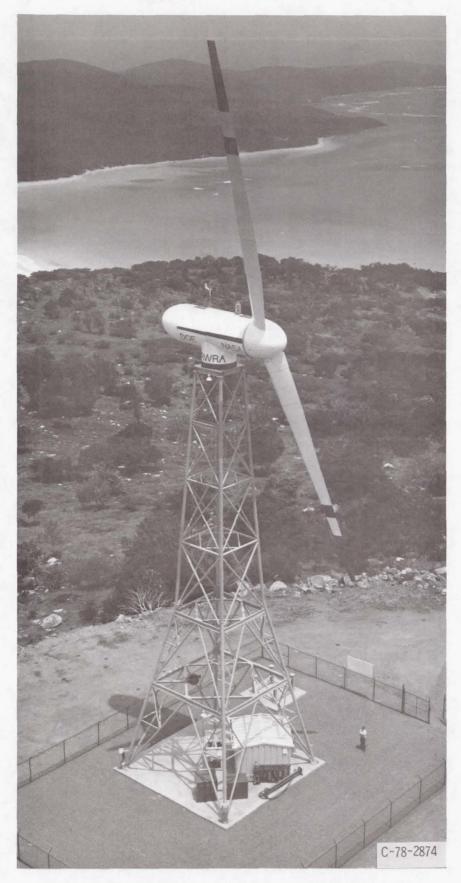


Figure 1. - MOD OA Wind Turbine at Culebra Island, Puerto Rico.

# MOD-OA 200 kW WIND TURBINE SCHEMATIC OF NACELLE INTERIOR

PITCH FLUID COUPLING 7 DISK BRAKE ANEMOMETER/WINDVANE > GEAR BOX V-BELTS ¬ 40 rpm HYDRAULIC SUPPLY -1800 rpm BEDPLATE ROTOR BLADES -1/6 rpm YAW BRAKE ALTERNATOR J YAW DRIVE CD-12362-44

Figure 2. - Cutaway drawing of tower mounted equipment.

CONTRACT NO.				D. R. NO.	
FACILITY CLAYTON		DISCREPANCY REPORT	2066 PROJECT 200 KW WT6 DA-1		
PART NO.		REPORTER	PROJECT WAS DAY!		
JSED ON DWG.		R. SHALTENS	and for		
		PROJENG TECH SERVICES	DATE		
PITCH HAD SYS		RAQA CONTRACTOR	PROJENG TECH SERVICES DATE  RAGA CONTRACTOR 11 SEP 78		
AFFECTS FLIGHT HARDWARE		REPORTER NOTIFIED	MR REQUIRED YES NO		
YES NO		PROJ ENG R&QA			
MR/MRB DISPOSIT	ION KEPLACE H	L.P. DEVALIN SEE	E EUOIT 215	3_	
	CORRECTIVE ACTION	MR/MRB	TECH SERVICES BUY-OFF	QUALITY	
PROJ ENG			TECH SERVICES		
			TECH SERVICES		
			TECH SERVICES		

Figure 3. - Typical discrepancy report.

1. Report No. NASA TM-82803	2. Government Acce	ssion No.	3. Recipient's Catalog No.		
4. Title and Subtitle	and the second s				
AND QUALITY ASSURA	6. Performing Organization Code 776-33-41				
7. Author(s) William E. Klein	8. Performing Organization Report No. $E-1142$				
9. Performing Organization Name and	Address		10. Work Unit No.		
National Aeronautics an Lewis Research Center	11. Contract or Grant No.				
Cleveland, Ohio 44135	13. Type of Report and Period Covered				
12. Sponsoring Agency Name and Add			Technical Memorandum		
U.S. Department of Energy	14. Sponsoring Agency Code Report No				
Washington, D.C. 2054	Division of Wind Energy Systems Washington, D. C., 20545				
of NASA TM-79284, "Modi by William E, Klein preser 16. Abstract	ified Aerospace Reliabilit nted at the Reliability and	y and Quality Assura Maintainability Sym	This report is a revised version cance Method for Wind Turbines, "posium, January 22-24, 1980.		
			Assurance (SR&QA) approach		
			d 0A. The SR&QA approach to		
			o the public or operating person-		
			ate reliable operation and would		
			ments for future wind turbine		
			am is to provide wind power at a		
			tivities were to be accomplished		
			ted of modified Failure Modes		
			hardware inspection during parts		
			ring machine construction and		
that it should be consider			approach has worked well enough		
that it should be conside	sted by others for simi	itat projects.			
17. Key Words (Suggested by Author)	(c) )	10 Distribution State			
System safety; FMEA; Safety; Low costs;		18. Distribution Statement Unclassified - unlimited			
Hazard analysis; Metho		STAR Category 38			
assurance; Reliability	dology, quality	DOE Category UC-60			
appurance, iteriability		DOD Categor	.,		
19. Security Classif. (of this report)	20. Security Classif.	(of this page)	21. No. of Pages 22. Price*		
Unclassified		laggified			

